

6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
1	Chinese chestnut	41, (41)	80	Shade	Low	FIVE YEARS	TWO YEARS	
Notes	Longevity rating - < 10							

**Root Collar**

**Trunk**

Included bark

**Leaves**

Dead twigs/Branches

**Twigs**



6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
2	Cherry <i>Prunus spp.</i>	34.25, (34.25)	25	Shade	High	ONE YEAR		remove and grind stump
Notes	Tree was measured incorrectly- tree is under the 36" DBH MARK NO COMPENSATION							

### Root Collar

Decay

### Trunk

Heartwood decay  
Cavity/Nest hole

### Leaves

Dead twigs/Branches

### Twigs

Weak attachments



6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
3	Pin oak	32, (32)	10	Dead	High	IMMEDIATELY	IMMEDIATELY	remove and grind stump
<b>Notes</b>	Declined beyond recovery Tree is below the 36" DBH MARK - no compensation							

**Root Collar**

**Trunk**

Heartwood decay

**Leaves**

Dead twigs/Branches

**Twigs**

Dead/Missing bark



6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
4	Cherry <i>Prunus spp.</i>	35, (35)	70	Orname ntal	Low			
Notes	Tree measured incorrectly- under the 36" DBH MARK - no compensation							

**Root Collar**

**Trunk**

Included bark

**Leaves**

Dead twigs/Branches

**Twigs**

Cankers/Galls/Burls





6/16/2017

## Tree Assessment Matrix

Client: Grappone  
East Baltimore Pike - 802-806  
East Pa

Inspector John Rockwell Hosbach, RCA  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
5	Cherry <i>Prunus spp.</i>	37, (37)	80	Orname ntal	Low	FOUR YEARS	TWO YEARS	
Notes	Compensation required							

**Root Collar**

**Trunk**

Cankers/Galls/Burls

**Leaves**

Dead twigs/Branches

**Twigs**

6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
6	Norway maple <i>Acer platanoides</i>	45, (45)	20	Invasive	High	IMMEDIATELY	IMMEDIATELY	remove and grind stump
Notes	Invasive species - no compensation Severe decay							

### Root Collar

### Trunk


Heartwood decay  
Cavity/Nest hole

### Leaves

Dead twigs/Branches

### Twigs

Heartwood decay  
Cavity/Nest hole

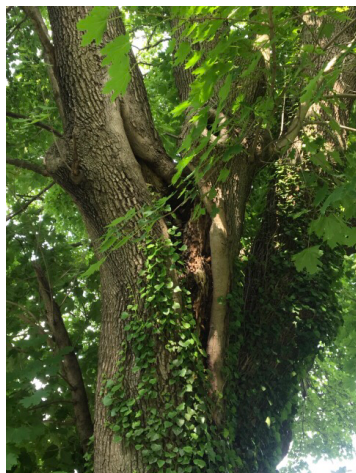



6/16/2017

## Tree Assessment Matrix

Client: Grappone  
East Baltimore Pike - 802-806  
East Pa

Inspector John Rockwell Hosbach, RCA  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
7	Green ash <i>Fraxinus pennsylvanica</i>	47, (47)	70	Shade	High	TWO YEARS	TWO YEARS	remove and grind stump
Notes	Emerald ash borer threat - tree does not warrant treatment							

**Root Collar**

**Trunk**

Included bark  
Codominant stems

**Leaves**

Dead twigs/Branches  
Broken branches/Hangers

**Twigs**



6/16/2017

## Tree Assessment Matrix

Client: Grappone  
East Baltimore Pike - 802-806  
East Pa

Inspector John Rockwell Hosbach, RCA  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
8	Norway maple <i>Acer platanoides</i>	41.5, (41.5)	10	Dead	High	IMMEDIATELY	IMMEDIATELY	remove and grind stump
Notes	Declined beyond recover- high risk Invasive species - no compensation							

### Root Collar

Decay

### Trunk

Heartwood decay

### Leaves

Dead twigs/Branches

### Twigs

Dead/Missing bark



6/16/2017

## Tree Assessment Matrix

**Client:** Grappone  
**East Baltimore Pike - 802-806**  
**East Pa**

**Inspector John Rockwell Hosbach, RCA**  
Registered Consulting Arborist #483  
ISA Certified Arborist PD-0372  
ISA Tree Risk Assessment Qualified

Tree	Species	DBH (in)	Condition	Contr.	Risk	Priority	Cycle	Mitigation/Management
9	Tulip poplar	37, (37)	85	Shade	Low	FIVE YEARS	FIVE YEARS	
Notes								

**Root Collar**

**Trunk**

**Leaves**

Dead twigs/Branches

**Twigs**

